

634-011

Dart Aerospace Ltd.

Date: Thursday, 06/11/2008 2:22:21 PM  
 User: Julie Dawson

## Process Sheet

<b>Customer</b>	: CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b>	: SKID TUBE ASSEMBLY
<b>Job Number</b>	: 43239A		
<b>Estimate Number</b>	: 10023		
<b>P.O. Number</b>	:	<b>Part Number</b>	: D205634041
<b>This Issue</b>	: 06/11/2008	<b>S.O. No.</b>	:
<b>Prsht Rev.</b>	: NC	<b>Drawing Number</b>	: D2580 REV D
<b>First Issue</b>	: / /	<b>Project Number</b>	: N/A
<b>Previous Run</b>	: 43237A	<b>Drawing Revision</b>	: D
<b>Written By</b>	:	<b>Material</b>	:
<b>Checked &amp; Approved By</b>	: <u>JUL 08.11.06</u>	<b>Due Date</b>	: 19/11/2008
<b>Comment</b>	: Est Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ Est Rev: O 06.02.28 Added paperwork EC Est Rev:P 07-07-09 SS Wearplates & Gaskets JLM		

Qty: 1 Um: Each

## Additional Product

Job Number:



<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile &amp; type labels per PPP D205-634-041 CHG002

N/A



2.0	D25001190	Ext'n - 1' Beam Tube 4"
-----	-----------	-------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	B-4/0150-AWM 8-11-07

3.0	D2596	Web, 205 Skidtube
-----	-------	-------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2596	205 Web	43108

AWM 8-11-07



4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburr ends

3-Acid etch and Alodine tube per QSI 005 4.1

AWM 8-11-07

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 06/11/2008 2:22:21 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43239A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

ET 08-11-07

6.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

3-Countersink holes as per Dwg D2580without cutting fluid

4-Deburr and blow out all chips from inside of tube

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 109449

Sikaflex expire date: 8-12-1

Start Time: 10:35 Date: 8-11-7

Fin Time: 745 Date: 8-11-11

ET 08-11-07

SL 8-11-7

7.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

108-11-11

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

AWM 8-11-11

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 06/11/2008 2:22:21 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43239A

Part Number: D205634041

Job Number:



Seq. #: Machine Or Operation: Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*JE 8-11-11*

10.0

D25763

Step (maching detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2576-3	Step	<i>B3B392</i>

*JE 8-11-12*

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
20	D2579	Spacers	<i>B-41432</i>

*Ann*

*20P25X 5-11-11*

12.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

*m109813*

*JE 8-11-12*

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

*m109813*

*JE 8-11-12*

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Debur holes

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

*7*  
*JD*  
*8-11-12*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action		Sign & Date	Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng				

**NOTE:** Date & initial all entries

Date: Thursday, 06/11/2008 2:22:21 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43239A

Part Number: D205634041

Job Number:



Seq. #: Machine Or Operation:

Description :

13.0 QC10

VISUAL INSPECTION OF GROUND WELDS



08/11/12

Comment: VISUAL INSPECTION OF GROUND WELDS

14.0 QC5

INSPECT WORK TO CURRENT STEP



08/11/12

Comment: INSPECT WORK TO CURRENT STEP

15.0 HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FD 08/11/12 (P)

16.0 POWDER COATING

POWDER COATING



M109152

(1X)

Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

2:15  
320 OF  
2:45

M-H 08/11/12

17.0 QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



HL

Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-11-13

(X)

18.0 D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap

Batch: 1341340

HL

19.0 AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: M1100188

HL

08-11-13

(X)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

**NOTE:** Date & initial all entries



Date: Thursday, 06/11/2008 2:22:21 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43239A

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

20.0	AN960JD10L	Washer
------	------------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: M1105793 *JA*

21.0	ALS71032130	Insert
------	-------------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

Insert

Batch: M1105819 \* *JA*

22.0	AN3C4A	BOLT
------	--------	------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

BOLT

Batch: M1109431 *JA*

23.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

washer

Batch: M1109752 *JA*

24.0	D356613	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B41862 *JA*

25.0	D35665	Gasket
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B41467 *JA*

26.0	D35661	Gasket
------	--------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

GASKET

Batch: B42237 *JA* 08.11.13 *(V)*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 06/11/2008 2:22:21 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43239A

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

27.0	D356413	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1341933

JU

28.0	D356411	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1342248

JU

29.0	D35649	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1342258

JU

30.0	D35645	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1342236

JU

31.0	D25943	O-Ring, 205 Skidtube
------	--------	----------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: 1329908

JU

32.0	D25941	Plug, 205 Skidtube
------	--------	--------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: 1341434

JU

33.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

11104444

JU

08-11-13

CD

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 06/11/2008 2:22:21 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43239A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

✓ Sikaflex expire date: 08/11

✓ 2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

✓ 3-Inspect for foreign object per QSI 024

✓ 4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M109406

Sikaflex expire date: 08/11

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: M109219

08-11-13  
(X)

- FL 08/11/13 (1)

34.0

QC5

INSPECT WORK TO CURRENT STEP



08-11-13 (1)

Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev:

PAN 43239 08/11/13 (1)

36.0

QC21

FINAL INSPECTION/W/O RELEASE



08/11/13 JF

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



mf 08-11-13

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

**NOTE:** Date & initial all entries

**DART**

DESIGN #	DRAWN BY RH	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

**RELEASED**  
07-06-28 #

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

**GENERAL NOTES:**


- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:  
SEE NOTES ON  
PAGE 2 FOR D2580-041 AND  
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
4323917


**Copyright © 1996 by DART AEROSPACE LTD**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

**DETAIL A**  
SCALE 5:24

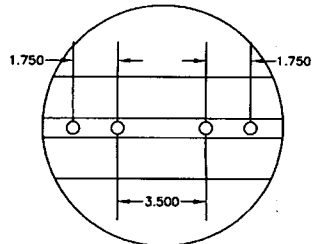


**DETAIL B**  
SCALE 5:24

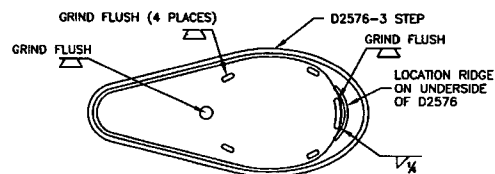


**RELEASED**  
07 Dec 84

**DETAIL C**  
SCALE 5:24

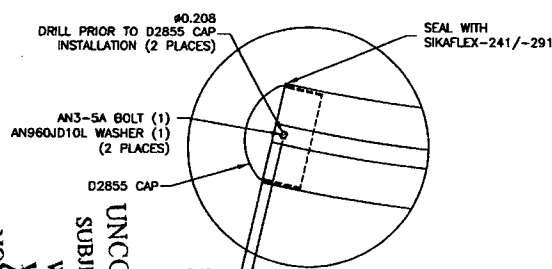


**SECTION D-D**  
SCALE 5:24

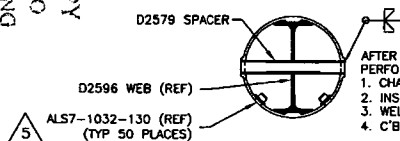


AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:  
1. CHAMFER HOLE 0.050 X 45°  
2. INSERT D2579 SPACER (20 PLACES)  
3. WELD INTO PLACE AND GRIND FLUSH  
4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP


**D2580-1 DRILLING DETAIL**

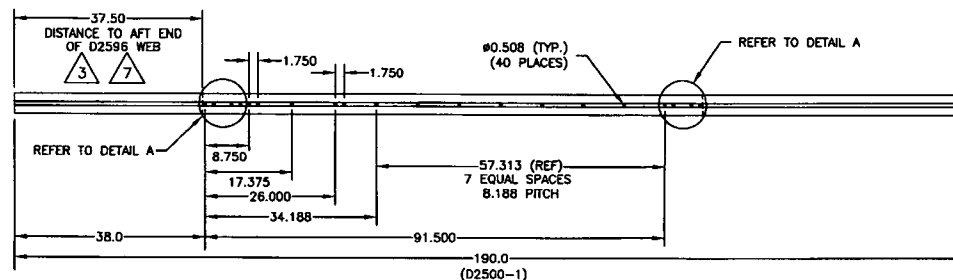

**D2580-1 BENDING AND CUTTING DETAIL**

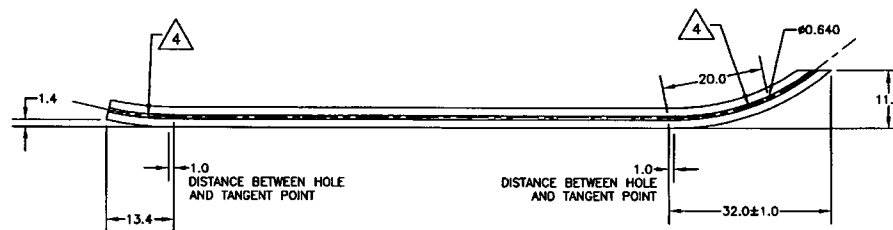

**D2580-041 ASSEMBLY DETAIL**

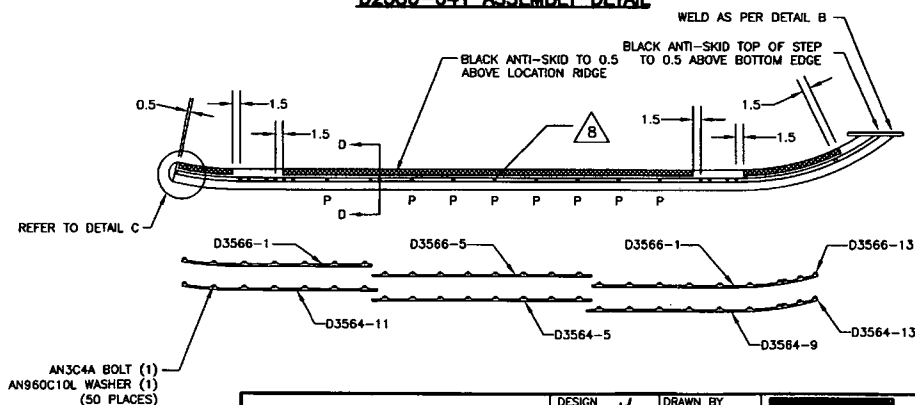

**D2580-041 NOTES**

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB  
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

COPYRIGHT © 1986 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE LTD.

DESIGN	DRAWN BY	<b>DART</b>	DART AEROSPACE LTD.
CHECKED	APPROVED	DRAWING NO.	REV. D
DATE		D2580	SHEET 2 OF 3
07.02.27		TITLE	SCALE
		205 SKIDTUBE ASSEMBLY	1:24



Diagram illustrating the grinding and finishing steps for the propeller cross-section:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- GRIND FLUSH
- LOCATION RIDGE ON UNDERSIDE OF D2576
- $\frac{1}{4}$

RELEASED  
07-16-28

Technical drawing of a circular component, likely a cap or cover, showing various parts and dimensions. The drawing includes the following annotations:

- #0.208**: Dimension for the hole diameter.
- DRILL PRIOR TO D2855 CAP INSTALLATION (2 PLACES)**: Instruction for drilling two holes.
- SEAL WITH SIKAFLEX-241/-291**: Instruction for sealing the component.
- AN3-5A BOLT (1)**: Specification for one bolt.
- AN960JD10L WASHER (1)**: Specification for one washer.
- (2 PLACES)**: Indication for two locations.
- D2855 CAP**: Identification of the cap part.
- SEE NOTE ii)**: Reference to a note.
- 0.40**: Dimension for the hole spacing.

D2579 SPACER

WEB (REF)

130 (REF)  
0 PLACES

AFTER PERFO  
1. CHA  
2. INS  
3. WEI  
4. C'B


- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

[illegible]

(MAKE FROM D2580-1 DRILLING DETAIL)

Technical drawing of a propeller shaft showing dimensions and hole locations. The shaft has a total length of 51.340. Key dimensions include a 1.4 offset at the left end, a 5.985 offset for the first hole, a 5.338 (REF) offset for the second hole, a 3.630 (REF) offset for the third hole, a 5.915 offset for the fourth hole, and a 20.0 offset for the fifth hole. The shaft has a diameter of  $\phi 0.508$  (8 PLACES) and a final diameter of  $\phi 0.640$  at the right end. The distance between the first hole and the tangent point is 1.0, and the distance between the last hole and the tangent point is 1.0. The total distance between the first and last hole is 32.0  $\pm$  1.0. A 13.4 dimension is shown at the left end. A 11.5 dimension is shown at the right end. A 4 is indicated at the left end.

 [illegible]

COPYRIGHT © 1996 BY DART AEROSPACE LTD.  THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	DESIGN	DRAWN BY	 <b>DART AEROSPACE LTD.</b> MARKHAM, ONTARIO, CANADA		
	CHECKED	APPROVED		DRAWING NO.	REV. D
				D2580	SHEET 3 OF 3
	DATE	TITLE		SCALE	
07.02.27	205 SKIDTUBE ASSEMBLY		1:24		